


21 MY Rogue – ECU Configuration Error Code C9004 with Windows 7

1. The 2021 MY Rogue uses an on-line method for configuring ECUs (if required). If a Windows 7 CONSULT PC does not have the latest Windows updates, the following error may occur during the configuration writing.



2. Use a Windows 10 CONSULT PC to complete the configuration and/or apply the latest Windows 7 updates to current PC.
3. To update your Windows 7 PC go to Control Panel/System and Security/Window Update. Click "Check for updates" and install the updates when prompted. This process may take up to 3 hours to complete.

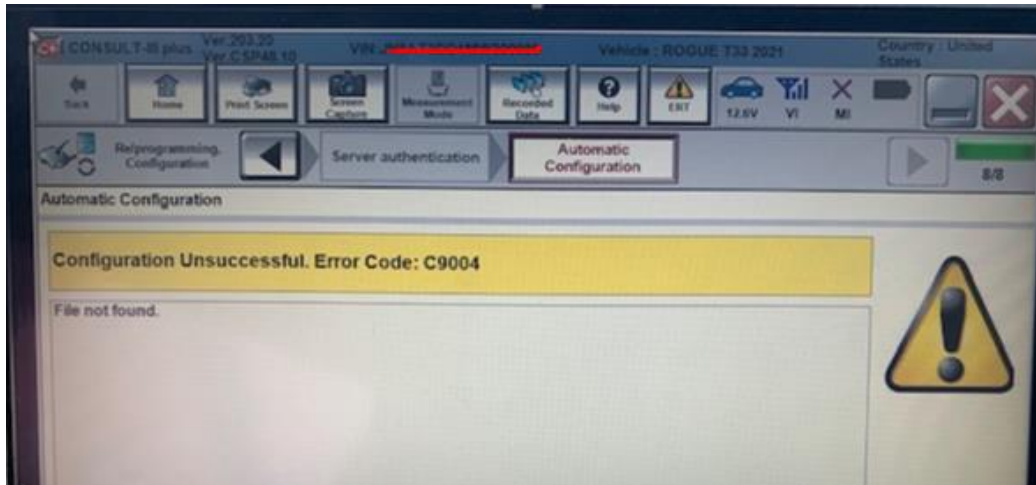